TEchnologyStandardizationInspection

Inspection Report


A. GENERAL	
Client Name:	XXXXXXXX
To:	XXX
From :	TS INSPECTION SERVICES
Project No.:	HIE12110009
Report No.:	HIE12110009
Inspection Date:	17-NOV-12
Report Issue Date:	17-NOV-12
Vendor/Supplier:	XXXX (HK) ELECTRONICS CO. LTD
Factory Name:	XXXXX (HK) ELECTRONICS CO. LTD
Factory Address:	SHENZHEN
PO. No.:	20120/20119
Product Description:	10" MID TABLET 16:9/7" MID TABLET 16:9
Item/Product No.:	GBT1040RS/ GBT740RS
Order Quantity:	500PCS+500PCS=1000PCS
Available Inspection Quantity:	1000PCS
Order Cartons:	75CTNS
Sample Size:	32PCS
Destination Country:	UK
Origin Country:	CHINA
Service Type :	FINAL RANDOM INSPECTION
Re-inspection :	NO

B. INSPECTION RESULT SUMMARY

	ACCEPTED	REJECTED	PENDING	N/A	REMARKS*
PRODUCT CONFORMITY (Section A)	X				
QUANTITY (Section D)			X		13
WORKMANSHIP/APPEARANCE/ FUNCTION (Section F)		X			
ON-SITE TESTS (Section G)			X		7,8
PACKING & ACCESSORIES (Section H)			X		13
LABELING&MARKING (Section I)			X		10
SHIPPING MARKS (Section J)			X		9
CLIENT SPECIFICATION			X		
OVERALL RESULT (Final decision from client) Failed beyond AQL					
* Refer to Section C for Remarks					

TS Inspection TechnologyStandardizationIn			
Report Date:Nov.17,2012	Project No.: HIE12110009	Report No.: HIE12110009	Page 2 of 36

C. IM	PORTANT REMARKS
1	The testing/measuring equipments applied during the inspection were all calibrated and within the period of validity. Yes (X); No ().
2	Client approved sample / inspection spec available for inspection reference at time of inspection: Sample: Yes (); No (X) -Factory Sample: Yes ().Client's Check list.: Yes (X), Packing list no.(PI. no.):_ /;Date:/No ().
3	Actual instruction manual was conformed to the product inside. Yes (X); No ();N/A()
4	Actual gift box was conformed to the product inside. Yes (X); No ();N/A()
5	The brand name AND country of origin marking see section "I".
6	Shipping mark details please see photo attachment.
7*	Factory didn't provide connection device for inspector to test ethernet
8*	Factory did not provide equipment for high/low temperature test/ battery capacity/Hi-Pot test on adapter.
9*	GBT1040RS: slight poor printing on shipping mark.
10*	First digital of Bar code on gift box is not scanned out
11	WIFI test from minimum 25 metres-OK
12	Touchscreen typing test with low battery and touchscreen typing test when connected to mains with low battery-OK
13*	Production was 100% finished, but only packed 1carton per item for packing inspection
Photo	s To Follow:

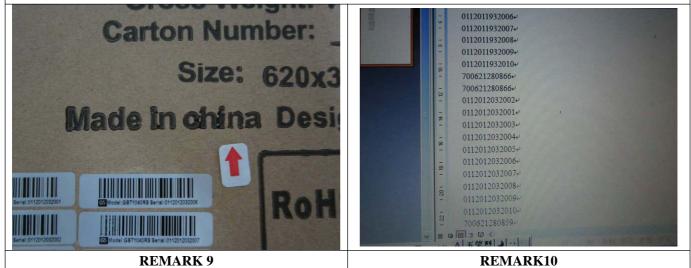

D. QUANT	TITY								
				Inspe	ction Qty				
PO. No.	Item No.	Order	Order	(1	PCS)	Sample Size	No of D	efects For	Sample
10.10.	Item NO.	Qty	Qty	Packed	Not	(PCS)	CR	MA	MI
		(PCS)	(CTN)	1 ackeu	Packed		CK	MIA	IVII
20120	GBT1040RS	500	50	/	500	16		6	
20119	GBT740RS	500	25	/	500	16		1	1

Inspection TechnologyStandardizationInspection

E. INSPECTION CRITERIA			
Inspection Standard:	ANSI/ASQ Z1.4 SINGLE SAMPLING PLAN (formerly known as MIL-STD-105)		
General Inspection Level - Workmanship / Visual/Function	G-I AQL - Critical Defectives: Expected hazard of human life, health or environment Allowed		
[X] Normal Inspection[] Reduced Inspection[] Tightened Inspection		AQL - Major Defectives: Usability or life time probably significant affected	2.5
Sample Size–CRI/MAJ/MIN:	32/32/32	AQL - Minor Defectives: Usability or life time probably less or not affected	4.0

F. WORKMANSHIP/APPEARANCE/ FUNCTION DEFECTIVES			
Description	Cri	Maj	Min
ITEM NO: (GBT740RS)			
Broken on QC label			1
Sometimes touch screen malfunction		1	
ITEM NO: GBT1040RS			
Display blue screen when tear up the touch screen protective film		1	
Screen flash /Unit dead when tear up the touch screen protective film		5	
Total Found:	0	7	1
Accept / Reject:	0/1	2/3	3/4
Result:	ACC	REJ	ACC

Note: A <u>Defective</u> is defined as a unit of product that contains one or more defects. A Defect is defined as any nonconformance of the inspected unit of product with specified requirements. A single defect is taken into account per each defective unit, in every case the most serious defect exhibited by the individual sample being inspected regardless of the characteristic.





Charging Test	4 HOURS	
Discharge Test	3.5 HOURS	
	(GBT740RS)7"1G	
RAM		
	(GBT1040RS)10"1G	
	(GBT740RS)7"4G	
STORAGE	(GBT1040RS)10"8G	
USB/SD Card Compatible	PASS	
Dead Pixel Check	PASS	

TS Inspecti TechnologyStandardizationIn	spection		
Report Date:Nov.17,2012	Project No.: HIE12110009	Report No.: HIE12110009	Page 5 of 36
Office Software			

Office Software	PASS
(Word, Excel, Email)	
TF card	PASS
Camera Function	PASS
Touch Capacity	PASS
Wifi Function	PASS
3GP Test	PASS
Online Chat Software	PASS
(MSN)	1100
Aging Test	PASS
Video/Audio Function	PASS
LCD Size Check	PASS
Adhesion Test/Rub test	PASS

MEASUREMENT DATA RECORD:			
	1. TS Inspection inspector randomly selected <u>32</u> PCS for visual & testing inspection.		
2. TS Inspection inspector	2. TS Inspection inspector randomly selected <u>3</u> PCS/item for aging test.		
Item No.S/N For InspectionS/N For Aging Test			

H. PRODUCT PACKAGING INFORMATION				
INDIVIDUAL PACKAGING: COLOR BOX				
EXPORT CARTON DETAILS:				
New or Used	New		Opaque Gummed Tape	No
Material	Cardboard	Cardboard Sealing	Transparent Gummed	1
Wateria	Caruboaru		Tape	1
Corrugated Paper Plies	5		Paper Tape	No
Fastening - Metal Staples	YES	Strapping	Nylon Band	No

I. LABELING / WARNING / MARKING			
Item No	Brand Name	Country Of Origin Location	Serial Number Location
GBT1040RS GBT740RS	XXXX	CARTON/GIFT BOX/UNIT	/

J. SHIPPING MARKS					
Shipping Marks on	$\begin{array}{c c} 2 & \text{Side} \\ (s) & \end{array}$	Side Marks on	2 Side(s)	Display Box Marks on	/ Side(s)
Refer to photo		Refer to photo		Refer to photo	


K. INFORMATION REMARKS

TS Inspection TechnologyStandardizationInst	pection				
Report Date:Nov.17,2012	Project No.: HIE12110009	Report No.: HIE12110009	Page 6 of 36		
· · · · · ·			· · · · · · · · · · · · · · · · · · ·		
1 [0] PCS of defective sa	 [0] PCS of shipment samples were collected by inspector. [0] PCS of defective samples were collected by inspector. The factory was asked to send the sample to the: N/A 				
	l conditions meet the requiren	nent: Yes [x],No []			
	the requirement: Yes [x],				
	1 27				
L. ATTACHMENTS					
Photos of item No.: GBT10	40RS				
	www.ErgoElectronics.com	R = R = R R = R = R R = R = R R = R = R R = R = R = R = R = R = R = R = R = R =			
REF: Quantity: Net Weight: Gross Weight: Carton Number Size: 620x32 Made In ohina Desig Made In ohina Desig RoHS	3.2Kg of. 50.Cartons 3x223mm				


mr





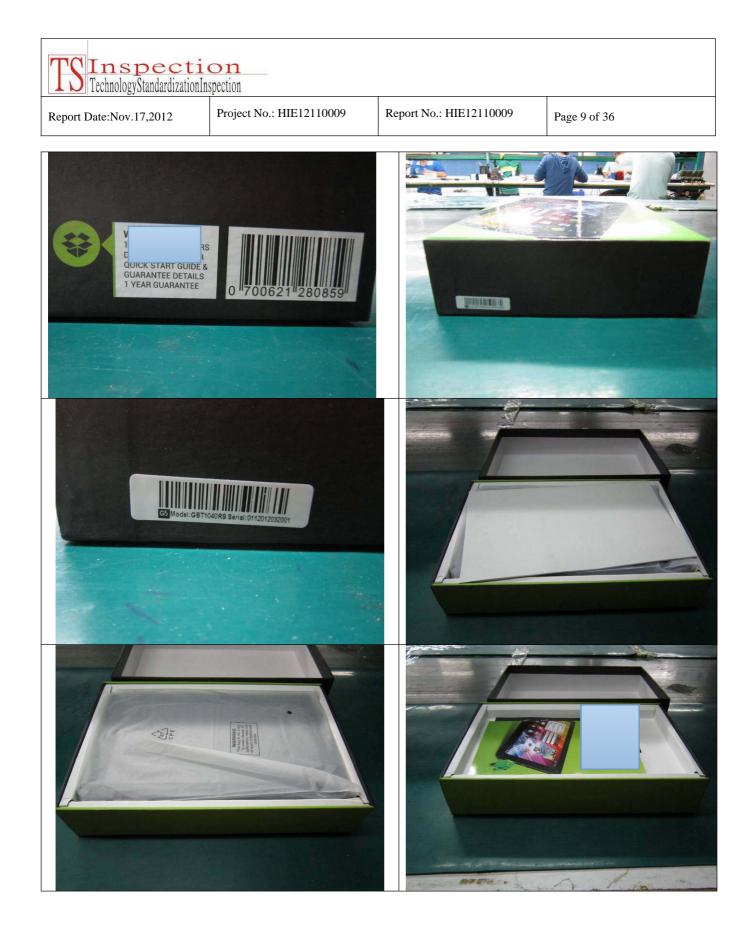




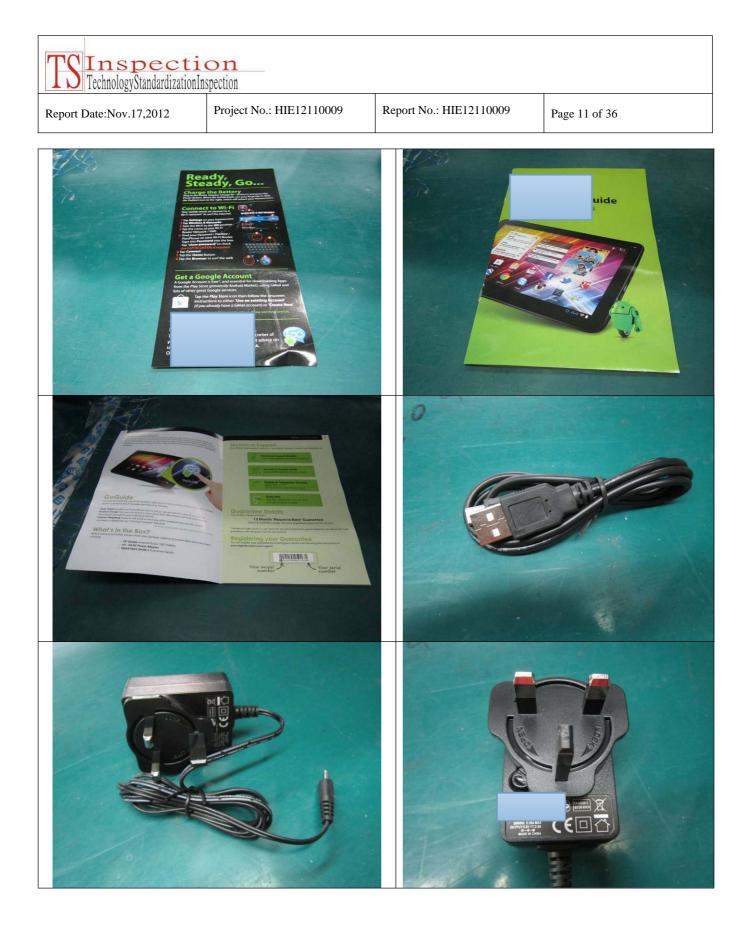











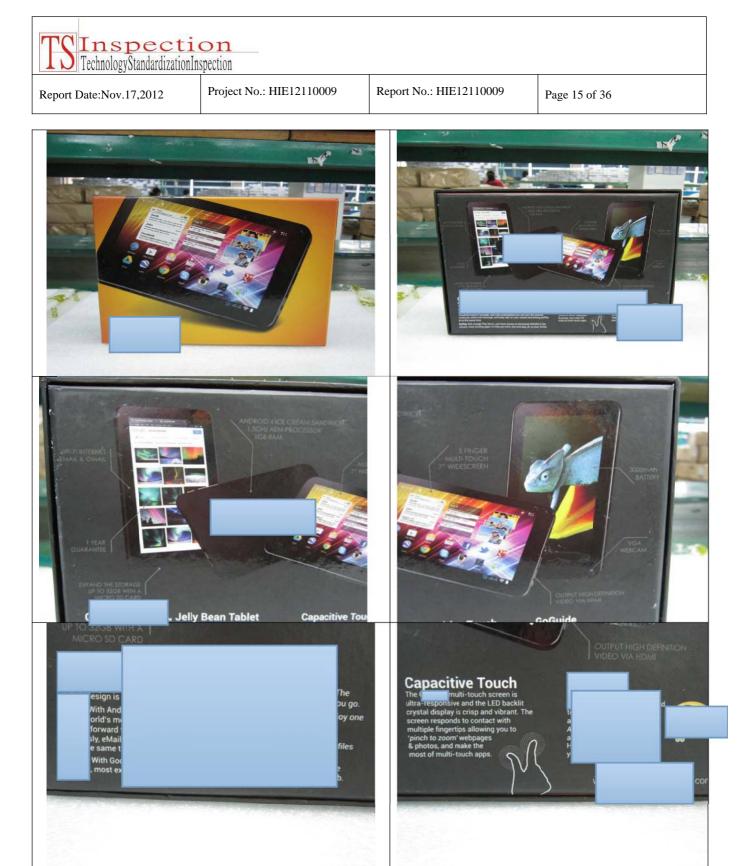


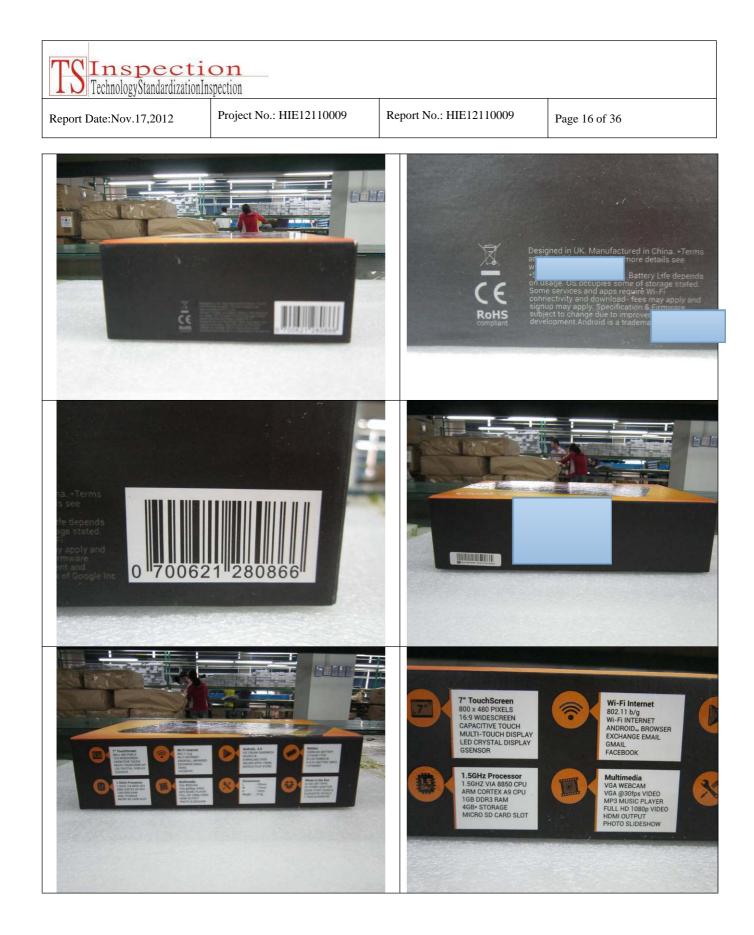

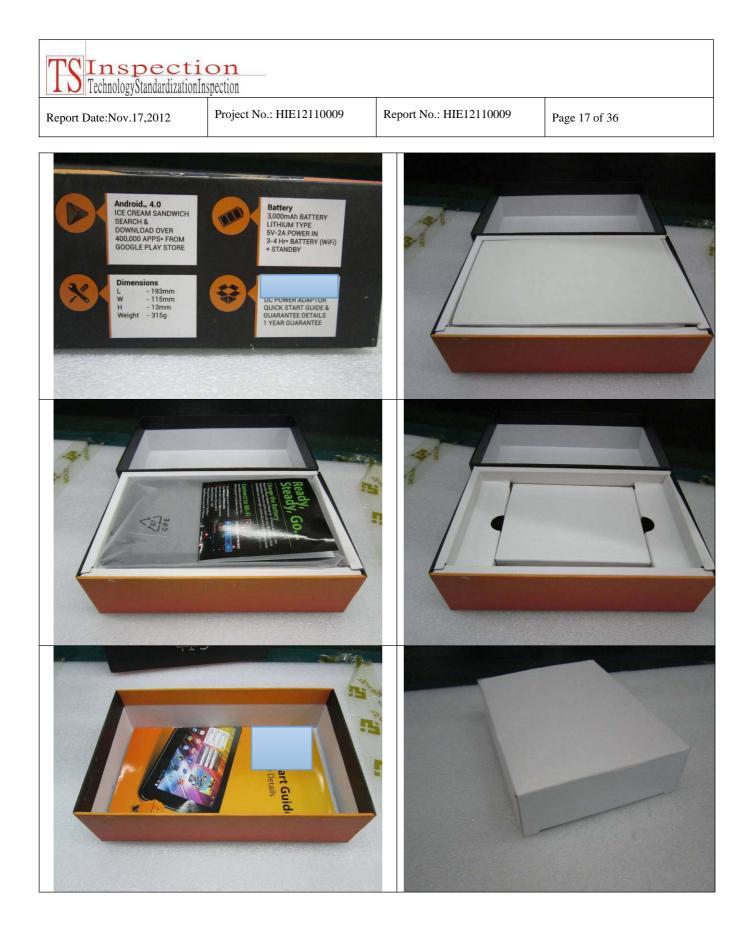

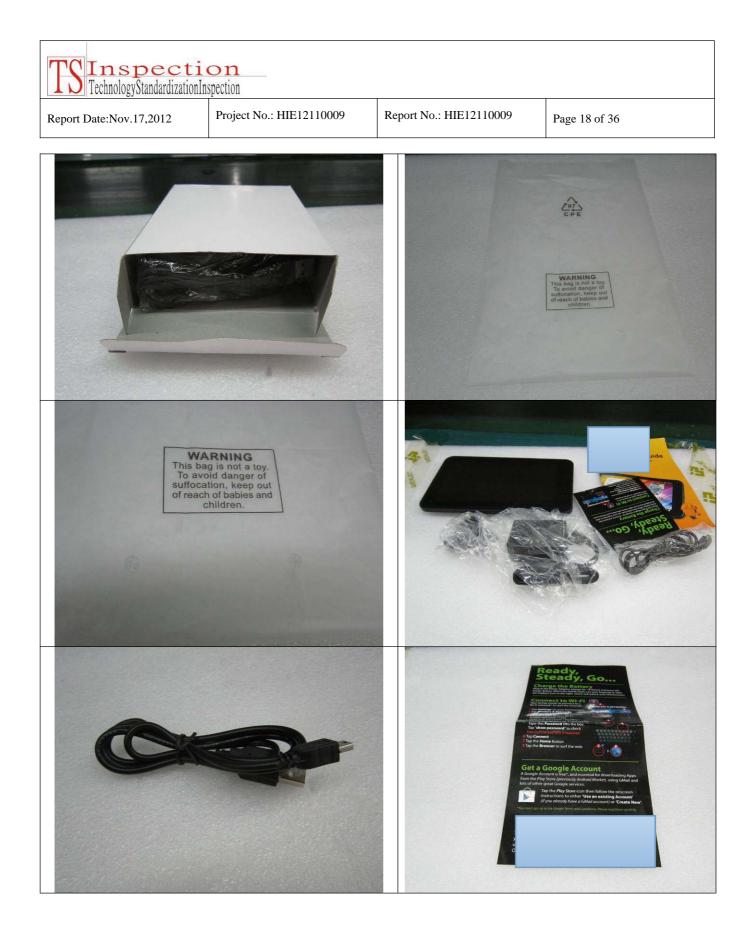


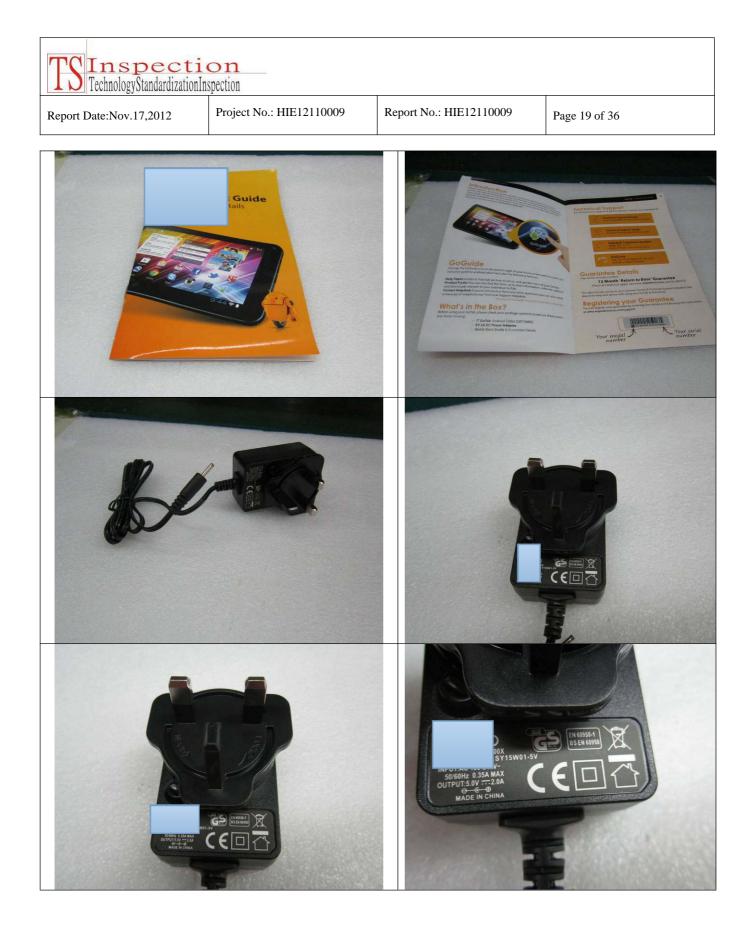

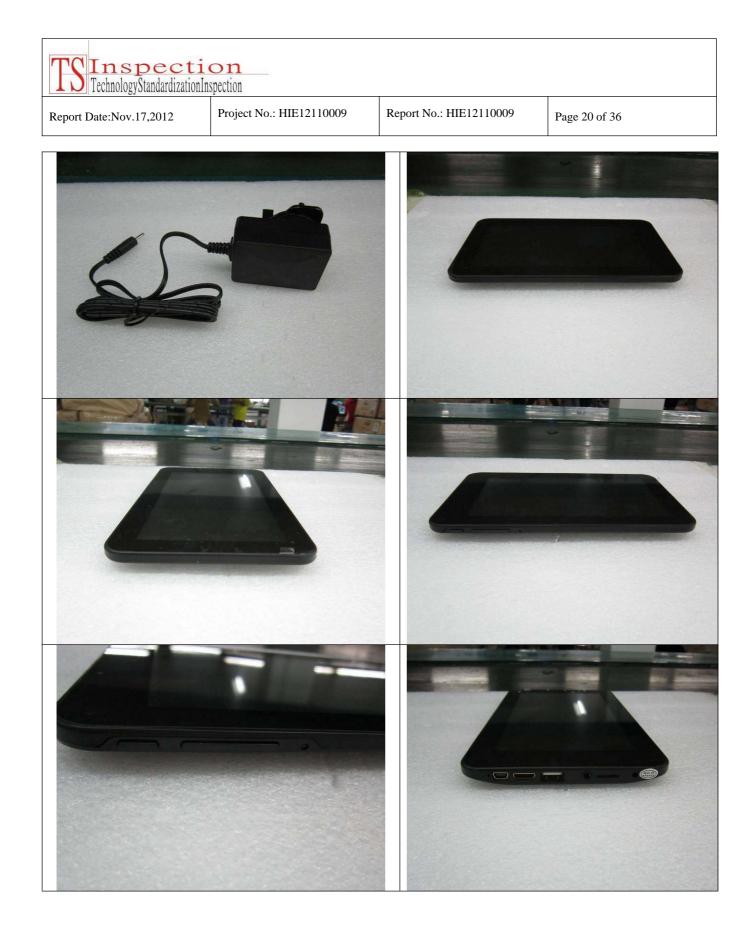





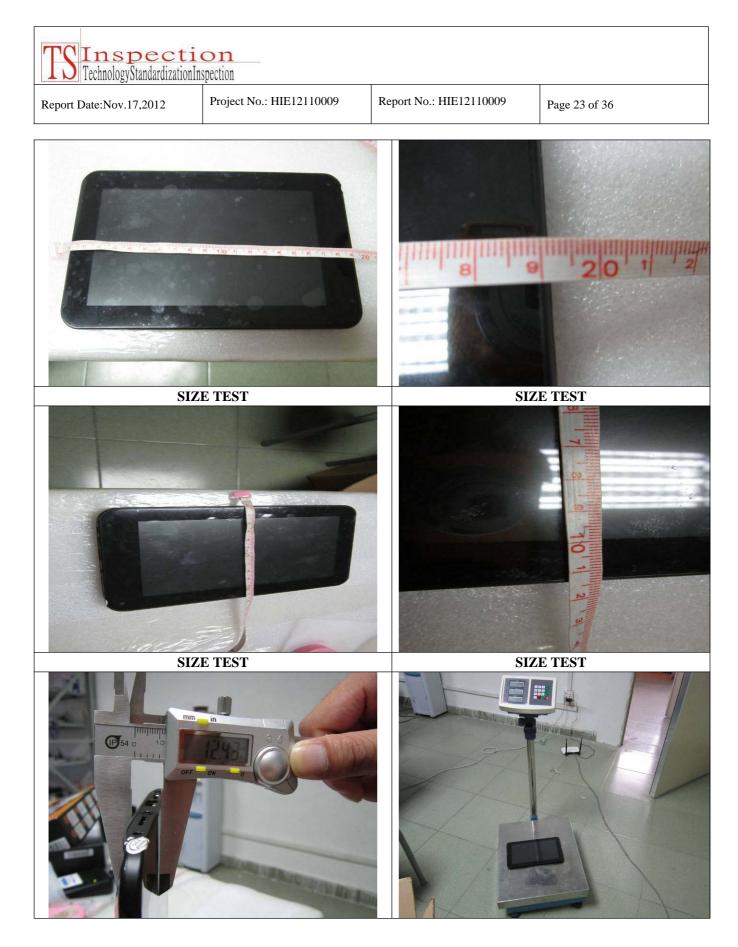

















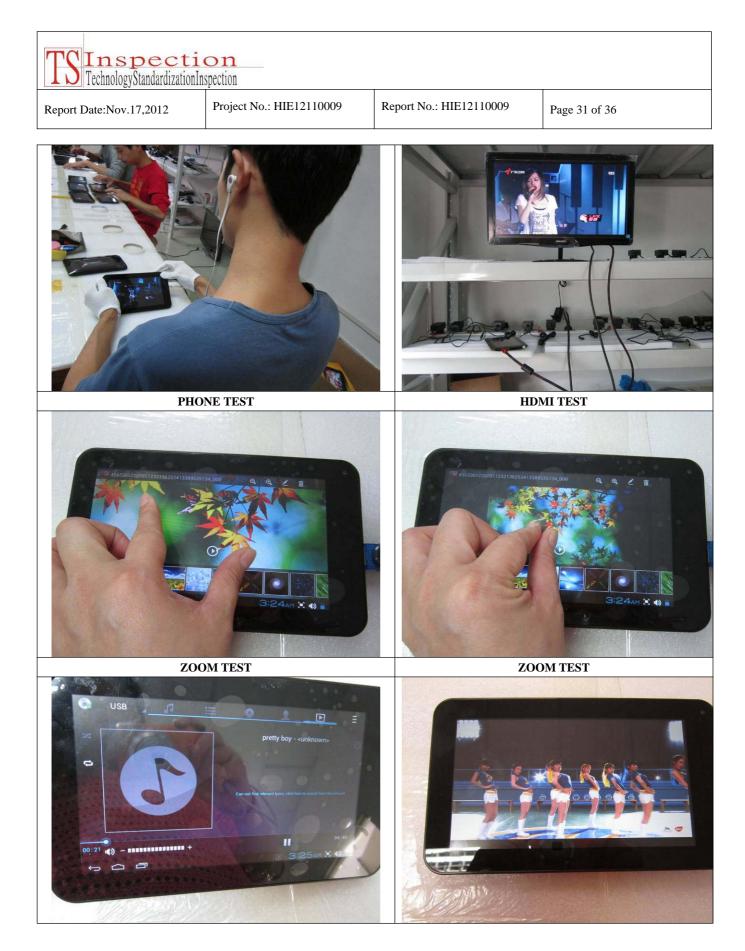



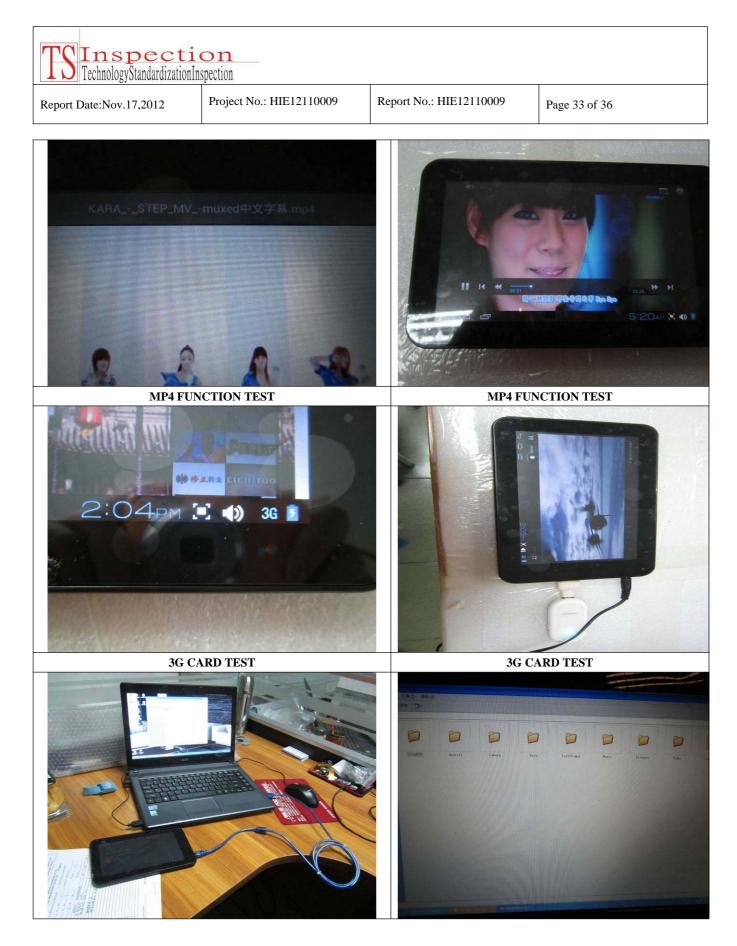



TS Inspection TechnologyStandardizationInspection			
Report Date:Nov.17,2012	Project No.: HIE12110009	Report No.: HIE12110009	Page 35 of 36
	REF: 7" GoTab GBT74 antity: 20Pieces eight: Kg eight: Kg nber:ofca 465x320x310mm Designed in UK RoHS CC C		
- 0112011932 - 0112011932 - 0112011932 - 0112011932 - 0112011933 - 0112011933 - 011201193 - 01120120 - 0120 - 0120 - 0120 - 0120	2002+ 2003+ 2005+ 2006+ 2006+ 2008+ 2009+ 2010+ 2010+ 2002+ 32002+ 32001+ 32003+ 32004+ 32005+ 32006+		932007+ 932008+ 932009+ 932010+ 180866+ 180866+ 18082004+ 1032005+ 1
BARCODE TEST BARCODE TEST 3 Other information:			

S Inspection TechnologyStandardizationInspection

Report Date:Nov.17,2012

Project No.: HIE12110009

Page 36 of 36



< REPORT>

The merchandise identified above was inspected for the client for quality, workmanship / construction and appearance. This Inspection Result relates exclusively to the work ordered and the lot inspected.

TSInspection inspector has discussed the results of this inspection with the authorized factory representative

Inspector Name:	Susan Zhao	Date:	2012-11-17
whom they are addressed. No quotation from rep- processes tested, examined or surveyed and are n sellers / suppliers from their contractual responsii compensation for any apparent and/or hidden def breach of statutory duty) or howsoever, and what damage of any nature whatsoever, shall be limite- part of TSI shall arise (whether under the express for any loss of whatever nature caused by the fau price under this Agreement and the said limitation incidental or consequential damage. The Custome above amount of compensation and shall not raiss undertaken on behalf of the Customer or in relati mark or trade name, the Customer shall indemnif fees in defending such action Provided Always th Customer shall pay the costs of any settlement or If there are any discrepancies between the Stated The inspection report reflects our findings at th	orts or use of the TSI's name is permitted except b ot necessarily indicative of the quality / quantity of the g pilities with regard to the quality / quantity of the g ects not detected during TSI's random inspection of ever the cause thereof, (a) for any loss of profit, bu d to the amount of the fee paid in respect of the spi or implied terms hereof or under the relevant Chin it or negligence of TSI or by any breach of its oblig n of liability shall apply regardless of the form of a er hereby acknowledges and states that its losses an e any further claim against TSI beyond such amou on to any of the Products or the Trade Mark or Pata y TSI harmless from any liability, action, claim, dc it the Customer will at its own election either effe compromise effected. All orders accepted and all Above and Terms and Conditions of Service, the S at time and place of inspection. This report or c	al of TSInspection . Reports of TSInspection are iss y TSI's express written authorization. Reports apply ttly identical or similar materials, products or proces goods in delivery nor do they prejudice the Custome r testing or audit. The liability of TSI to the Custom isiness, contracts, revenues, or anticipating savings; ecific Work(s) which give rise to such claim. [LIMI nese laws and regulations) in contract, tort or infring gations or howsoever caused shall be limited to the iction, whether in contract, tort, infringement or oth nd damages, whether direct or indirect, resulted ther nt. INDEMNITY: In the event of actual or threatene ent of the Customer or of any allegation of infringer emand, costs, charges and expenses arising <i>there fro</i> ct any settlement or compromise or at its own exper reports and cretificates issued are subject to the Tern Stated Above will prevail.] ertificate does not relieve sellers/suppliers from th appliers for compensation for any apparent and/or	y only to the specific materials, products or sses. Reports / Certificates of TSI do not relieve r's right to claim against sellers / suppliers for ner in contract, tort (including negligence or or (b) for any special indirect or consequential TATION OF LIABILITY: If any liability on the gement, the Customer's right to recover damages payment by TSI of the amount of the contract terwise. In no event shall TSI be liable for efrom will be sufficiently recovered by the ed suit against TSI in relation to the services ment of any letters patent, registered design, trade <i>m</i> or expense including solicitors fees, counsel's nse defend any such action or proceeding and the ms and Conditions of Service and Stated Above.

TSIGF08-001 (20081209)

End of Inspection Report